



SIGN PUNCHING, STRINGER AND SUPPORT LOCATION DETAILS - DIVIDED HIGHWAY CONTROL SIGNS

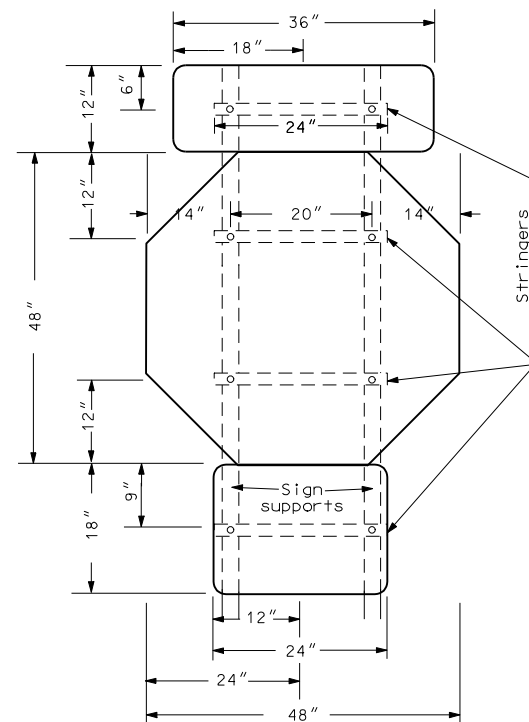


2 Posts

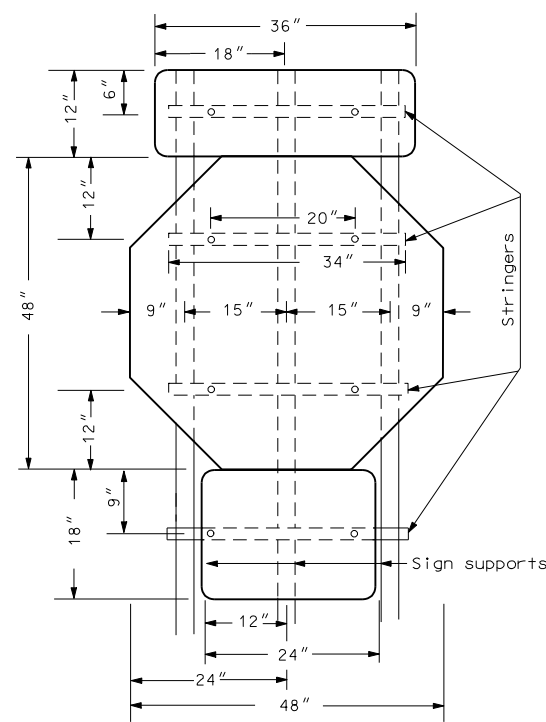


3 Posts


ASSEMBLY NO. 447 & 451

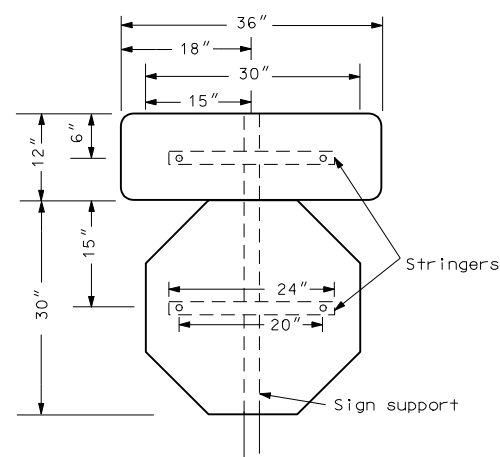

1 Post

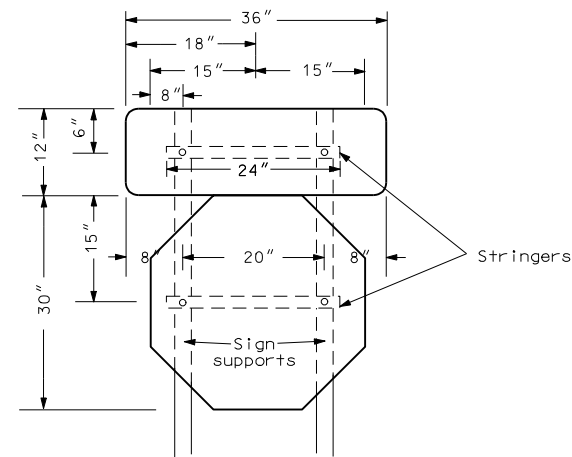

2 Posts

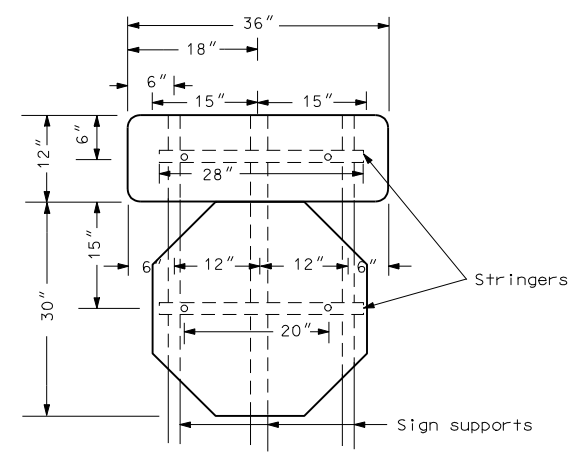

3 Posts

ASSEMBLY NO. 448 & 452

NOTES:

1. See standard D-754-24 for mounting details.
2. The minimum sign backing material thickness shall be 0.100 inch.
3. Perforated square tube stringer shall be $1\frac{1}{2}$ " x $1\frac{1}{2}$ ".
4. All holes shall be punched round for $\frac{3}{8}$ " bolt.
5. Assembly:
Single Sign: 447 and 448
One Way Back To Back: 451 and 452

NORTH DAKOTA DEPARTMENT OF TRANSPORTATION	
10-1-86	
REVISIONS	
DATE	CHANGE
05-01-92	General revisions
06-23-03	Layout revisions
10-13-04	Note revisions
12-01-04	PE Stamp added

This document was originally issued and sealed by MARK S GAYDOS, Registration Number PE-4518, on 12/01/04 and the original document is stored at the North Dakota Department of Transportation